



miamidade.gov

Water and Sewer
PO Box 330316 • 3071 SW 38 Avenue
Miami, Florida 33233-0316
T 305-665-7471

VIA ELECTRONIC CORRESPONDENCE

July 30, 2020

CCN: 63330
File No: 8.DC.20.32

Chief, Environmental Enforcement Section
Environment and Natural Resources Division
U.S. Department of Justice
P.O. Box 7611
Tom Mariani
Washington, D.C. 20044-7611
RE: DOJ No. 90-5-1-1-4022/1
Tom.Mariani@usdoj.gov

Chief, Clean Water Enforcement Branch
Water Protection Division
Attn: Brad Ammons
U.S. Environmental Protection Agency, Region 4
61 Forsyth Street, S.W.
Atlanta, Georgia 30303
Ammons.Brad@epa.gov

Rachael Amy Kamons
Environmental Enforcement Section
U.S. Department of Justice
P.O. Box 7611
Ben Franklin Station
Washington, D.C. 20044-7611
Rachael.Kamons@usdoj.gov

Florida Department of Environmental Protection
Southeast District – West Palm Beach
3301 Gun Club Road, MSC 7210-1
West Palm Beach, FL 33406
Attn: Compliance/Enforcement Section
Jason.Andreotta@dep.state.fl.us

**RE: Consent Decree (Case: No. 1:12-cv-24400-FAM),
Reference DOJ Case No. 90-5-1-1-4022/1,
Section IX – Reporting Requirements, Paragraph 32 – Quarterly Reports – 2020
Quarterly Report No. 2**

Dear Sir/Madam:


In accordance with the provisions of Paragraph 32 of the above referenced Consent Decree, on behalf of Miami-Dade County, the Water and Sewer Department (WASD) submits to the Environmental Protection Agency (EPA) and the State of Florida Department of Environmental Protection (FDEP) the 2020 Quarterly Report No. 2. The 2020 Quarterly Report No. 2 covers the period from April 1, 2020 through June 30, 2020.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or

persons who manage the system, or those persons directly responsible for gathering such information, the information submitted is, to the best of my knowledge and belief, true, accurate and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

Should you have any questions regarding this matter, please call me at (786) 552-8884.

Sincerely,

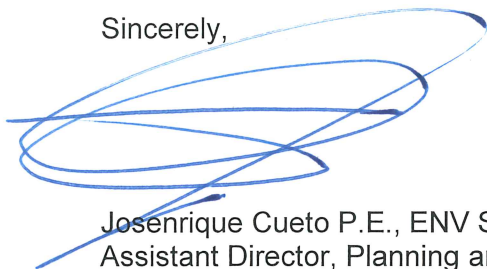

Josenrique Cueto P.E., ENV SP, LEED® Green Associate
Assistant Director, Planning and Regulatory Compliance

Attachment: 2020 Quarterly Report No. 2

ec: Barbara Jean Throne
Senior Assistant Attorney General, Complex Litigation
Office of the Attorney General
PL-01, The Capitol
Tallahassee, FL 32399-1050
850-414-3808
Barbara.throne@myfloridalegal.com

Florida Department of Environmental Protection
Southeast District – West Palm Beach
3301 Gun Club Road, MSC 7210-1
West Palm Beach, FL 33406
Attn: Compliance/Enforcement Section
Lisa.M.Self@dep.state.fl.us
Mike.Bechtold@dep.state.fl.us
Sed.wastewater@dep.state.fl.us
Megan.Ticknor@FloridaDEP.gov

Mayor Carlos A. Gimenez
Miami-Dade County
111 NW First Street 29th Floor
Miami, Florida 33128

Kevin T. Lynskey, Director
Miami-Dade Water and Sewer Department
3071 SW 38th Avenue
Miami, Florida 33146

Jack Osterholt, Deputy Mayor/Director
Miami-Dade Regulatory and
Economic Resources
111 NW 1st Street. 29th Floor
Miami, FL 33128
Josterholt@miamidade.gov

Henry Gillman
Miami-Dade Assistant County Attorney
Miami-Dade County Attorney's Office
111 NW First Street Suite 2810
Miami, Florida 33128

Richard Elliott, P.E., PMP
Environmental Engineer
Water Protection Division
U.S. Environmental Protection Agency - Region 4
61 Forsyth Street. S.W.
Atlanta, GA 30303
Elliott.Richard@epa.gov

Paul Schwartz
Associate Regional Counsel
U.S. EPA, Region 4
61 Forsyth Street, SW
Atlanta, Georgia 30303
Schwartz.Paul@epa.gov

William A. Weinischke
Senior Trial Attorney
Environmental Enforcement Section
Environment and Natural Resources Division
U.S. Department of Justice
P.O. Box 7611
Washington, D.C. 20044
Bill.Weinischke@usdoj.gov



2020 Quarterly Report No. 2 (Twenty-Fifth Quarterly Report)

April 1, 2020 through June 30, 2020

Prepared for

**United States Environmental Protection Agency and
Florida Department of Environmental Protection**

Consent Decree
Case: No. 1:12-cv-24400-FAM

Prepared by

Miami-Dade County, Miami-Dade Water and Sewer Department

**This Page Has Been Intentionally Left
Blank**

2020 Quarterly Report No. 2

1.0 Purpose

On April 9, 2014, Miami-Dade County (County) entered into a Consent Decree (CD) with the United States of America (United States), the State of Florida Department of Environmental Protection, and the State of Florida. The Consent Decree was lodged on June 6, 2013 and became effective on December 6, 2013. This document satisfies the requirements of Section IX, Paragraph 32 for submittal of the 2020 Quarterly Report No. 2 on or before July 30, 2020.

2.0 Requirements

Section IX, Paragraph 32 of the CD states: “Beginning one (1) month after the first Calendar Quarter following the Effective Date of this Consent Decree, and one (1) month after each Calendar Quarter thereafter until termination of the Consent Decree, Miami-Dade shall submit to EPA and FDEP for review and comment a Quarterly Report. Such Quarterly Report shall include the date, time, location, source, estimated duration, estimated volume, receiving water (if any) and cause of all SSOs occurring in the previous Calendar Quarter.” Section IV, Paragraph 8(ii) of the CD defines an SSO as any discharge of wastewater to waters of the United States or the State from Miami-Dade’s Wastewater Collection and Transmission System (WCTS) through a point source not permitted in any NPDES permit, as well as any overflow, spill, or release of wastewater to public or private property from the WCTS that may not have reached waters of the United States or the State, including all Building Backups – wastewater backups or releases caused by blockages, flow conditions or other malfunctions of a Private Lateral are not considered as Building Backups.”

3.0 Sanitary Sewer Overflow Events

This quarterly report contains additional information on how the Sanitary Sewer Overflow (SSO) was resolved, including the immediate fix and any proposed long-term solution. While not specifically required by the Consent Decree, the United States Environmental Protection Agency (EPA) has requested that the County provide this additional information to aid them in preparing the United States’ Semi-Annual Status Report to the United States District Court, Southern District of Florida, Miami Division.

The County shall not be held liable for stipulated penalties under Section X, Paragraph 42(vi) of the CD if the County “demonstrates that the SSO was caused by an Act of God, vandalism, a non-County Contractor, or any act of a third party not working directly or indirectly on behalf of Miami-Dade and that Miami-Dade demonstrates that it has used all reasonable measure to prevent such SSO.” During this reporting period, the County determined there were two (2) events that would qualify under Section X Paragraph 42 (vi) as described above. These SSO events are described in Table 1. Notice letters were sent to the liable contractors and invoices for the damages will be generated. The supporting documentation available to date can be found in Appendix A.

Table 1 – Description SSO Events Caused by Vandalism or Liable Third Party

	Date	Location	Overflow Volume (gallons)	Contractor or Vandalism
1	5/11/2020	19105 NW 47 AVE MIAMI GARDENS 33055	4,859	FERREIRA CONSTRUCTION
2	5/16/2020	SW 147 AVE & SW 293RD ST MIAMI-DADE 33033	221,460	EFFICIENT CONSTRUCTION ENTERP.

3.1 SSOs (Excluding Building Backups)

Table 2 (page 4) documents all SSO events, excluding Building Backups (BBUs), for the second calendar quarter of 2020. There was a total of thirty-eight (38) SSO events:

- Fifteen (15) events involved gravity mains
- Seventeen (17) events involved force mains
- Three (3) events involved automatic or manual air release valves
- Three (3) events involved pump stations

There were three (3) SSO events that reached the waters of the United States during this reporting period.

3.2 Building Backups

The County follows standard procedures to resolve and minimize the occurrence of Building Backups. These procedures have been re-evaluated in the development of the new CMOM Program Sewer Overflow Response Plan (SORP) required by the current Consent Decree. The SORP was submitted by the County to EPA/FDEP on July 2, 2015. The County received EPA/FDEP comments on the SORP on January 27, 2017 and submitted a response on March 28, 2017. The EPA and FDEP approved the SORP on August 15, 2017. The County is implementing these procedures.

Presently, the Department's procedures for the response to, and the reporting and documenting of Building Backups are different from those of SSOs within the Department's WCTS. Additionally, the "Time" and "Duration" parameters are seldom characteristically the same between the two types of SSO events. For these reasons, Building Backups are normally included in a separate table and the "N/A" designation used for some "Time" and "Duration" entries. Building Backup information is shown in Table 3 (Page 9)

4.0 Abbreviations/Acronyms

The following acronyms and abbreviations are used in the tables.

AC	Asbestos Cement
ARV	Manual Air Release Valve
AARV	Automatic Air Release Valve

ASSIS	Active As-Built Supplemental Information System
DI	Ductile Iron
CD	Consent Decree
CI	Cast Iron
CIP	Capital Improvement Project
FM	Force Main
FOG	Fats, Oils and Grease
FSE	Food Service Establishment
GIS	Geographic Information System
GM	Gravity Main
GSS	Gravity Sewer System
HDPE	High Density Polyethylene
LAT	Lateral
PCCP	Prestressed Concrete Cylinder Pipe
PIR	Project Initiation Report
PS	Pump Station
PVC	Polyvinyl Chloride
RER-DERM	Regulatory and Economic Resources, Division of Environmental Resources Management
VFD	Variable Frequency Drive

5.0 Amendment to Previous Quarterly Report

There are no amendments to previous quarterly report required at this time.

Table 2 - Sanitary Sewer Overflows

CCID	Date	Time	Location	Source	Est. Duration hr:min	Est. Volume gallons	Destination	Waters of US	Cause	Immediate Fix	Long Term Fix	
											Req'd	Solution
465587	4/6/2020	1:00PM	15830 SW 304 ST UNINCORPORATED MIAMI-DADE 33033	AARV	20 minutes	20	Billy's Big Lil Canal	Yes	Automatic ARV was leaking due to a failure of the rolling seal assembly	Replaced broken AARV with new AARV	Yes	Phase out AARV from manufacturer with repetitive failure
466063	4/15/2020	10:25PM	16558 NE 26 AVE NORTH MIAMI BEACH 33160	WASD Pump Station	1 hour 35 minutes	20	Land	No	Electrical equipment failure at PS 0468	Pump station operation was restored	No	No further action required
466155	4/17/2020	7:00PM	18720 NW 48 PL UNINCORPORATED MIAMI-DADE 33055	GM	3 hours	20	Land	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	No	No further action required
466182	4/18/2020	2:30PM	17902 NW 74 CT UNINCORPORATED MIAMI-DADE 33015	GM	1 hour 30 minutes	20	Land	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	Yes	Recommended for Smart Cover installation and RER- DERM to investigate
466424	4/23/2020	12:17PM	9990 SW 28 ST UNINCORPORATED MIAMI-DADE 33165	AARV	2 hours 43 minutes	30	Land	No	Leaking AARV due to grease and debris blockage	Replaced AARV	No	No further action required
466563	4/27/2020	9:00AM	20310 SW 105 AVE CUTLER BAY 33189	FM	2 hours 30 minutes	351249	Land	No	6" AC force main broken due to unknown causes	Repaired 6" AC broken force main	Yes	Recommended for replacement
466692	4/29/2020	8:30AM	19301 NW 47 AVE MIAMI GARDENS 33055	FM	1 hour	8969	Land	No	8" AC force Main leaking due to inferior AC pipe material	Repaired 8". AC force main broken	Yes	Recommended for replacement
467124	5/5/2020	6:12PM	104 SW 9 ST MIAMI 33130	GM	33 minutes	25	Storm Drain	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	No	No further action required
467168	5/6/2020	2:41PM	7900 ISLAND BLVD AVENTURA 33160	FM	3 hours 39 minutes	80833	LITTLE MAULE LAKE	Yes	18" DI force main broken due to external corrosion	Repaired 18" DI force main broken due to external corrosion	Yes	Recommended for replacement

Table 2 - Sanitary Sewer Overflows

CCID	Date	Time	Location	Source	Est. Duration hr:min	Est. Volume gallons	Destination	Waters of US	Cause	Immediate Fix	Long Term Fix	
											Req'd	Solution
467499	5/11/2020	4:41PM	19105 NW 47 AVE MIAMI GARDENS 33055	FM	1 hour 49 minutes	4859	Land	No	4" CI force main broken by non-County contractor	Repaired broken 4" CI force main	Yes	Non-County contractor billed for damages
467782	5/16/2020	1:01AM	SW 147TH AVE & SW 293RD ST UNINCORPORATED MIAMI-DADE 33033	FM	1 hour 29 minutes	221460	Storm Drain	No	10 in DI force main broken by County contractor due to improper restrained pipe	Repaired 10 in force main broken by non-County contractor	Yes	County Contractor billed for damages and repairs
467986	5/19/2020	7:00AM	2700 SW 8 ST MIAMI 33135	GM	30 minutes	10	Storm Drain	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	No	No further action required
468222	5/21/2020	3:33PM	5313 NE 1 AVE MIAMI 33137	GM	47 minutes	50	Storm Drain	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	No	No further action required
468275	5/22/2020	11:00AM	901 NW 22 AVE MIAMI 33125	GM	1 hour 15 minutes	10	Storm Drain	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	No	No further action required
468367	5/24/2020	1:45PM	SW 119 AVE & SW 178 TER UNINCORPORATED MIAMI-DADE 33177	FM	3 hours 12 minutes	107071	Storm Drain	No	12" CI force main broken due to split on pipe	Repaired 12" CI force main broken .	No	No further action required

Table 2 - Sanitary Sewer Overflows

CCID	Date	Time	Location	Source	Est. Duration hr:min	Est. Volume gallons	Destination	Waters of US	Cause	Immediate Fix	Long Term Fix	
											Req'd	Solution
468521	5/25/2020	6:30PM	19993 S DIXIE HWY CUTLER BAY 33157	FM	2 hours 20 minutes	89225	Storm Drain	No	10" AC force main, broken due to inferior AC material.	Repaired 10" AC broken force main.	Yes	Capped and abandoned 10" AC force main on June 24, 2020
468527	5/25/2020	6:30PM	SW 92 AVE & SW 48 TER UNINCORPORATED MIAMI-DADE 33165	FM	3 hours 10 minutes	105956	Storm Drain	No	10" DI force Main broken due to split on pipe	Repaired broken 10" DI force main	No	No further action required
468597	5/26/2020	10:50AM	1176 NW 79 ST UNINCORPORATED MIAMI-DADE 33150	FM	1 hour 10 minutes	19717	Storm Drain	No	12" DI force main broken due to external corrosion	Repaired 12" force main broken due to external corrosion	Yes	Recommended for replacement
468603	5/26/2020	1:00PM	NW 57 AVE & NW 183 ST UNINCORPORATED MIAMI-DADE 33055	WASD Pump Station	3 hours 30 minutes	120	Land	No	PS 415 failure due to debris clogging pumps	Cleared blockage and PS operation restored	No	No further action required
468720	5/27/2020	8:30AM	19370 COLLINS AVE SUNNY ISLES BEACH 33160	GM	15 hours	18000	Storm Drain	No	Gravity main blockage due to grease	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	Yes	Recommended for Smart Cover installation and RER- DERM to investigate
468728	5/27/2020	9:14AM	14421 SW 115 TER UNINCORPORATED MIAMI-DADE 33186	FM	2 hours 46 minutes	53050	Storm Drain	No	8" PVC force main broken due to point loading	Repaired 8" PVC force main	No	No further action required
468743	5/27/2020	11:56AM	SW 17 AVE & S DIXIE HWY MIAMI 33133	GM	1 day 22 hours 4 minutes	184000	Storm Drain	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain receded	No	No further action required
468758	5/27/2020	10:00AM	11991 SW 34 ST UNINCORPORATED MIAMI-DADE 33175	WASD Pump Station	45 minutes	100	Land	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain recede	No	No further action required
468767	5/27/2020	11:56AM	2226 SW 16 AVE MIAMI 33145	GM	1 day 22 hours 4 minutes	2800	Storm Drain	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain receded	No	No further action required

Table 2 - Sanitary Sewer Overflows

CCID	Date	Time	Location	Source	Est. Duration hr:min	Est. Volume gallons	Destination	Waters of US	Cause	Immediate Fix	Long Term Fix	
											Req'd	Solution
468772	5/27/2020	11:56AM	SW 22 TER & SW 3 AVE MIAMI 33145	GM	1 day 22 hours 4 minutes	85000	Storm Drain	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain receded	No	No further action required
468776	5/27/2020	11:56AM	SW 22 ST & SW 16 AVE MIAMI 33145	GM	1 day 22 hours 4 minutes	3280	Storm Drain	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain receded	No	No further action required
468778	5/27/2020	11:56AM	3479 SW 3 AVE MIAMI 33145	GM	1 day 22 hours 4 minutes	3100	Land	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain receded	No	No further action required
468866	5/28/2020	12:30PM	SW 67 AVE & SW 152 ST PALMETTO BAY 33158	FM	30 minutes	11267	Land	No	8" DI Force Main broken due to external corrosion	Repaired 8" force main broken due to external corrosion	Yes	Force main is under review for further recommendations
468872	5/28/2020	1:30PM	785 NE 77 ST MIAMI 33138	GM	1 hour 30 minutes	320	Land	No	Heavy rain events over multiple days exceeded system surcharged	Systems equalize to normal levels after the rain receded	No	No further action required
468885	5/28/2020	3:24PM	9325 NW 50 CIRCLE DR	FM	1 hour 36 minutes	12757	Storm Drain	No	6" DI force main broken due to point load	Repaired 6" DI force main.	No	No further action required
468891	5/28/2020	4:00PM	3979 RICKENBACKER CSWY UNINCORPORATED MIAMI-DADE 33149	FM	30 minutes	7087	Land	No	8" DI force main broken due to point of load	Repaired broken 8" DI force main	Yes	Recommended for replacement
468937	5/28/2020	9:00PM	710 NE 29 ST MIAMI 33137	GM	2 hours	220	Storm Drain	No	Gravity main blockage due to grease and paper	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	No	No further action required
469154	6/1/2020	9:00AM	7790 NW 114 AVE DORAL 33178	AARV	10 minutes	100	Land	No	AARV leaking at the threads on the nipple	Replaced AARV	No	No further action required
469184	6/1/2020	4:45PM	NE 26 AVE & NE 163 ST NORTH MIAMI 33160	FM	1 hour	7319	OLETA RIVER	Yes	6" DI force main was leaking due to a split on the pipe cause unknown	Repaired 6" DI force main broken	Yes	Recommended for replacement

Table 2 - Sanitary Sewer Overflows

CCID	Date	Time	Location	Source	Est. Duration hr:min	Est. Volume gallons	Destination	Waters of US	Cause	Immediate Fix	Long Term Fix	
											Req'd	Solution
469414	6/4/2020	10:00AM	19113 NW 47 AVE MIAMI GARDENS 33055	FM	1 hour	17727	Land	No	10" AC force main broken due to non-County contractor performing excavation near AC FM	Repaired 10" AC force main broken.	Yes	Recommended for Replacement
469489	6/5/2020	10:00AM	11147 SW 88 ST UNINCORPORATED MIAMI-DADE 33176	GM	1 hour 15 minutes	380	Storm Drain	No	Gravity main blockage due to grease and debris. Existing smart cover temporarily disabled	Cleared gravity main blockage and notified local regulatory agency (RER- DERM)	Yes	The smart cover system was placed back to normal operations
469734	6/9/2020	12:30PM	28801 SW 157 AVE UNINCORPORATED MIAMI-DADE 33033	FM	40 minutes	20	Land	No	6" AC force main, broken by non-County contractor while directional drilling	6" AC FM capped and abandoned	No	No further action
470304	6/18/2020	6:50PM	20033 S DIXIE HWY CUTLER BAY 33189	FM	1 hour 40 minutes	81831	Land	No	10" AC force main broken due to inferior material	Repaired 10" AC force main	Yes	Capped and abandoned 10" AC force main on June 24, 2020

Table 3 - Building Backups

CCID	Date	Time	Location	Source	Est. Duration hr:min	Est. Volume gallons	Destination	Waters of US	Cause	Immediate Fix	Long Term Fix	
											Req'd	Solution
N/A	4/6/2020	N/A	4970 NW 199TH ST, MIAMI GARDENS	LAT	N/A	6	N/A	N/A	Resident experience BBU caused by grease blockage in WASD system	Cleared grease blockage, system service restored to normal operation and vendor rendered assistance to clean and sanitize property.	No	No further action required
N/A	4/14/2020	N/A	3861 NW 187TH ST, MIAMI GARDENS	LAT	N/A	60	N/A	N/A	Resident experience BBU caused by WASD crew jetting sewer line.	System service restored to normal operation and vendor rendered cleaning / sanitizing	No	No further action required
N/A	5/18/2020	N/A	4000 NW 171ST TER, MIAMI GARDENS	LAT	N/A	5	N/A	N/A	Resident experience BBU due PM activities	System service restored to normal operation	No	No further action required
N/A	6/3/2020	N/A	1820 SW 89TH PL, MIAMI	LAT	N/A	5	N/A	N/A	Resident experience BBU due to roots intrusion in WASD's portion of lateral.	Cleared roots in lateral. Service restored	No	No further action required
N/A	6/11/2020	N/A	2010 NE 203RD ST, MIAMI	LAT	N/A	4	N/A	N/A	BBU in resident's multiple bathrooms due to WASD PM activities	Vendor rendered assistance cleaning and sanitizing.	No	No further action required
N/A	6/24/2020	N/A	200 S ISLAND DR, GOLDEN BEACH	LAT	N/A	2	N/A	N/A	BBU caused by Contractor's debris (rock and sand) in WASD gravity main	Cleared gravity main blockage. System service restored to normal operation and vendor rendered cleaning / sanitizing	No	No further action required

Appendix A

Supporting Documentation for SSO Events

Supporting document for May 11, 2020 Event on 19105 NW 47 Ave Miami Gardens caused by non-County Contractor

Figure 1 - Notice letter to contractor



Water and Sewer
PO Box 330315 3071 SW 38 Avenue
Miami, Florida 33233-0316
T 305-665-7471

07/23/2020 Certified 7006 0810 0004 0694 4436

FERREIRA CONSTRUCTION SOUTHERN DIVISION
9455 NW 104 ST
MEDLEY, FL 33178

Attn: ACCOUNTS PAYABLE

Re: File No: JS07844 Customer No. 00020933

Expenses incurred by Miami Dade Water & Sewer Department to repair and restore service to a damaged 4-inch (AC) sewer force main at 19105 NW 47th Ave. The damage occurred during work operation to install a drainage for FDOT. The 4-inch AC sewer force main was marked correctly. The incident was reported to Miami Dade Water & Sewer Department by Albert, a representative for Ferreira Construction. The contractor was working under Sunshine State One-Call Location Ticket # 119001264.

Damage/Repair Date: 5/11/2020

This is to advise you that your company is being held liable for the above-referenced utility damage resulting from your work operation.

An invoice with the costs incurred by our Department to repair and restore service to this utility, including restoration of the area if required, will be sent to your attention. This amount is to be paid in full within 380 days of the invoice date.

Any questions concerning this matter should be referred to Eva Rodriguez at (786) 552-8223 or, (786) 552-8171. Thank you for your cooperation.

Sincerely,

Controller Division
Special Collections Unit

c: File

7006 0810 0004 0694 4436

PLEASE AFFIX THIS LABEL TO THE FRONT OF THE MAIL PIECE TO BE TRACKED.

CERTIFIED MAIL

7006 0810 0004 0694 4436

7006 0810 0004 0694 4436

U.S. Postal Service
CERTIFIED MAIL - RECEIPT
(Domestic Mail Only) No Insurance Coverage Provided

For delivery information visit our website at www.usps.com

OFFICIAL USE

Postage \$	
Certified Fee	
Return Receipt Fee <small>(Receiptment Required)</small>	
Postnet Delivery Fee <small>(Receiptment Required)</small>	
Total Postage & Fees \$	

ADDRESSEE: Ferreira Construction

OR PO Box No: 330787

CITY, STATE, ZIP+4: _____

PS Form 3825, June 2002 See Reverse for Instructions

Supporting document for May 16, 2020 Event on SW 147 Ave & SW 293rd St
Miami-Dade 33033 caused by non-County Contractor

Figure 2 - Notice letter to contractor



Water and Sewer
 PO Box 330316 * 3071 SW 38 Avenue
 Miami, Florida 33233-0316
 T 305-665-7471

07/23/2020 Certified 7006 0830 0004 0694 4443

EFFICIENT CONSTRUCTION ENTERPRISE INC.
 9425 SW 72 STREET, SUITE 126
 MIAMI, FL 33173

Attn: STEPHANIE E. GODOY

Re: File No: JS07848 Customer No. 00021880

Expenses incurred by Miami Dade Water & Sewer Department to repair and restore service to a damaged 10-inch sewer force main at SW 147th Ave & 293rd St. The damage occurred during work operation to install a gravity sewer line for Miami Dade Water & Sewer Dept. The 10-inch sewer force main was damaged due to the removal of the thrust block. The incident was reported to Miami Dade Water & Sewer Department by representative for Efficient Construction. The contractor was working under Sunshine State One-Call Location Ticket # 066000256. Damage/repair date 5/16/2020

This is to advise you that your company is being held liable for the above-referenced utility damage resulting from your work operation.

An invoice with the costs incurred by our Department to repair and restore service to this utility, including restoration of the area if required, will be sent to your attention. This amount is to be paid in full within 360 days of the invoice date.

Any questions concerning this matter should be referred to Eva Rodriguez at (786) 552-8223 or, (786) 552-8171. Thank you for your cooperation.

Sincerely,

Controller Division
 Special Collections Unit

c: File

U.S. Postal Service CERTIFIED MAIL[®] RECEIPT <small>(Domestic Mail Only; No Insurance Coverage Provided)</small>	
<small>For delivery information visit our website at www.usps.com.</small>	
OFFICIAL USE	
Postage	\$
Certified Fee	
Return Receipt Fee <small>(Business Reply Mailpiece)</small>	
Restricted Delivery Fee <small>(Business Reply Mailpiece)</small>	
Total Postage & Fees	\$
Sent To: <u>Efficient Construction</u> Street, Apt. No., or PO Box No. <u>JS07848</u> City, State, ZIP+4 [®]	
<small>PS Form 3800, June 2002 See Reverse for Instructions</small>	